

March 1997

TOPIC: UNABLE TO LEVEL MOWER DECK

MODELS

AFFECTED: PCZ22K ZERO-TURN RIDERS

Serial no. 101-250

Field reports have indicated a potential problem with leveling the rear of the mower deck as outlined in the setup instructions. To rectify this, two (2) new rear deck suspension chains (50901-6) need to be installed. This will allow the spring rod to be properly adjusted to obtain the correct deck level as specified in the setup instructions.

NOTE: This procedure should only be performed after the standard chains will not raise the rear of the deck to the setup height. Installing the new chains on a machine that will properly adjust with the original chains will greatly reduce the strength of the engagement between the spring rod and the ball joints that screw into it and could result in a failure.

