

October 1997

TOPIC: KOHLER SMART SPARK™ IGNITION INCOMPATIBILITY

MODELS

AFFECTED: H22 SERIES 3-WHEEL RIDERS - serial no. 6153-7490
H32 SERIES 3-WHEEL RIDERS - serial no. 739-972
PROCUT Z - serial no. 101-700

Ferris Industries has determined that Kohler's Smart Spark™ Ignition system is incompatible with the safety interlock (21885).

To rectify this problem, a Interlock Relay Harness (45152) is available through the Parts Department.

Installation Instructions:

1. Park machine on a flat, level surface and apply parking brake.
2. Remove dash panel. (Riders)
3. Remove and discard the interlock.
4. Unplug the wire harness from the key switch (5-lead connector only).
5. Plug the Interlock Relay Harness into the key switch and plug the wire harness into the Interlock Relay Harness.
6. Plug the Interlock Relay Harness into the interlock connector and secure with the supplied zip-tie. (as shown below)
7. Fasten the Interlock Relay Harness to the column (Riders); wire harness (PCZ).
8. Reinstall the dash panel. (Riders)

\$20 labor will be paid.

