



April 2003

TOPIC: POSSIBLE PINCHED OR KINKED FUEL HOSES

MODELS

AFFECTED: IS3000ZFKAV2561 - S/N: 101-1320
IS3000ZXK27/61 - S/N: 101-503

Field reports have indicated an increasing number of complaints of no fuel delivery to the engine during the setup on new units.

Ferris has discovered that excess fuel hose to the fuel shut off valve is bending at the valve, causing a restriction.

If this problem is found on a unit, the repair procedure is as follows:

1. Remove the brake cover panel assembly and check for kinks in the fuel hoses.
2. If a kink is found, reinstall the brake cover panel while pulling the excess fuel hoses through the grommet in the frame to bring the excess hose away from the valve.

Unit should be run on both fuel tanks prior to delivery to confirm the repair.