

READ & ROUTE

Dealer _____ Service Technician _____ Parts Department _____
 Service Mgr. _____ Service Technician _____ Sales Department _____

TOPIC:

Fuel Filter Abrasion Failure

MODELS & SERIAL NUMBERS AFFECTED:

Models:
All IS1500Z Models

Serial Numbers:
101-1984

SUBJECT:

The above model number and serial numbers range units have the potential to rub against the engine housing and main frame, causing a filter failure.

CORRECTIVE PROCEDURES:

1. Park machine on a flat, level surface and apply the parking brake. Disengage the PTO switch, turn off engine and remove the key from the ignition.
2. Disconnect fuel hose from fuel tank and fuel pump.
3. Reconnect the fuel hoses with the 16" length to the fuel pump and the 6" length to the tank (Figure 1).
4. Remove and reinstall the fuel filter with the flow arrow pointing towards the fuel pump (see insert, Figure 1).
5. Install the 14" length of wire loom (supplied) over the fuel hose between the filter and pump.
6. Secure the hose to the hydro tank mount bracket with the supplied tie wrap. Do not over-tighten.

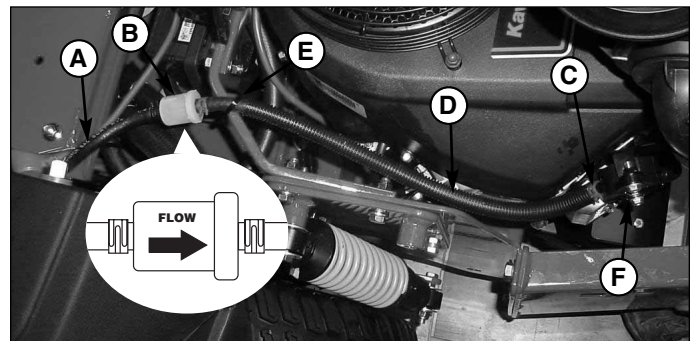


Figure 1. Fuel Hose Routing

- | | |
|----------------|--------------|
| A. 6" Hose | D. Wire Loom |
| B. Fuel Filter | E. Tie Wrap |
| C. 16" Hose | F. Fuel Pump |

WARRANTY INFORMATION:

Failure Type:

Failure Code:

Cause of Failure:

Work Performed: Repaired per Service Bulletin F076

Repair Parts:	Qty.	Part No.	Description
	1	50833-14	Wire Loom, 14"
	1	21029	Tie Wrap, 11"

Eligible for Pickup and Delivery Reimbursement If Performed:

Total Hours: No 0.3