

SERVICE**BULLETIN****SB #:** F113**BRANDS:****DATE:** FEBRUARY 2013**TO:** ALL AUTHORIZED FERRIS DEALERS**SUBJECT:** RECOMMENDED DRIVE TENSIONING SPRING UPDATE ON FERRIS IS600Z & IS700Z UNITS**MODELS:** SEE LIST BELOW

Brand	Model Numbers	Serial Number Range	Description
Ferris	5901212, 5901213, 5901222, 5901223	2016391792 & Below	Ferris IS600Z Series Zero-Turn Riding Mower
Ferris	5901214, 5901215, 5901224, 5901225, 5901226	2016391792 & Below	Ferris IS700Z Series Zero-Turn Riding Mower

DESCRIPTION

Due to inconsistent spring life on IS600Z and IS700Z series zero-turn riding mowers we have issued this bulletin detailing a recommended inspection and correction procedure to update the drive tensioning spring.

INSPECTION

1. Raise the seat plate to gain access to the drive tensioning spring.
2. Visually examine the spring.
 - If the spring (**A**, **Figure 1**) has a short forward hook (**B**) proceed to **Correction Procedure**;
 - If the spring (**A**, **Figure 2**) has a long forward hook (**B**), no action is necessary.

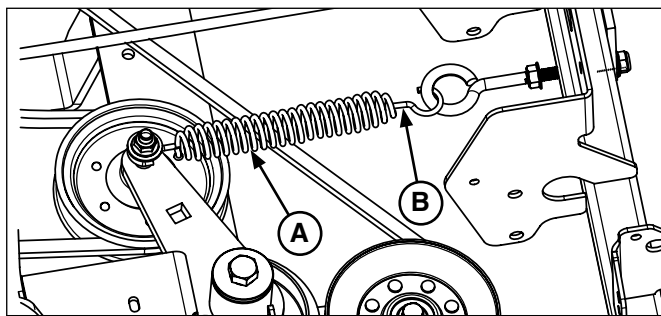


Figure 1. Old Style Drive Tensioning Spring (Replace)

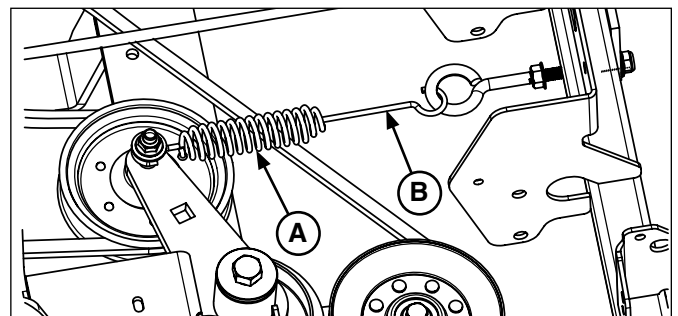


Figure 2. New Style Drive Tensioning Spring (No Action Required)

CORRECTION PROCEDURE

1. Order and install kit # 5600670.

WARRANTY:

File for warranty reimbursement using e-Claim at www.ThePowerPortal.com. Use the values listed below when filling out the claim. The information in the “Brand” block indicates which tab the claim should be filed under. *Note: File only one unit per claim form.*

Brand	Ferris		
Failure Location Category	L&G - Motion Drive	Cause of Failure	F113
Failure Location Code	F35	Work Performed	F113
Defect Code/Failure Mode	AW	Repair Parts Used	5600670 (Qty: 1)
Control/Evaluation Number	F113		
Pick-Up & Delivery	N/A		
Total Hours (Tenths):			
Inspection Only	0.1		
Inspection & Repair	0.4		

BRIGGS & STRATTON POWER PRODUCTS GROUP, LLC
Distribution Sales & Customer Support